



PENDANTS: one

MOUNTING: mini outie canopy 38mm (1.5") in diameter x 16mm

(0.6") deep

LAMPING: 1.5w LED or 20w xenon

COAX: adjustable. 3000mm (10') standard / up to 30500mm

(100') maximum

MATERIALS: blown glass, braided metal coaxial cable, electrical

components, white polyurethane canopy

WEIGHT: approximately 1.1kg (2.4lb)

POWER remote mounted (fixture does not hook directly to a

SUPPLIES: junction box). Power supplies included

## DESCRIPTION

The 'mo' designation in this 28 variant refers to the mini outie canopy. The mini outie canopy is 38mm (1.5') in diameter and 16mm (0.6") deep, which creates a subtle profile that will essentially disappear into the application surface. The pendant drop lengths on this light fixture are adjustable up to the specified maximum

28 is an exploration of specificity in manufacturing. Instead of designing form itself, here the intent was to design a system of making that yields form. Individual 28 pendants result from a complex glass blowing technique whereby air pressure is intermittently introduced into and then removed from a glass matrix which is intermittently heated and then rapidly cooled. The result is a distorted spherical shape with a composed collection of imploded inner shapes, one of which acts as a shade for the light source.

Standard 28s are made with clear glass exterior spheres and milk white interior lamp holder cavities. 28s are possible with infinite versatility in colour compositions, sizes and shapes.

## NOTES

- + Purchase replacement lamps online at www.bocci.com/shop/bulbs
- + Unless otherwise noted when ordering, all fixtures will be outfitted to be xenon compatible
- + Requires power supplies to be remote mounted

US Patent # D687,740 EU Patent # 001695834-001 to 004





Made in Vancouver, Canada


Vancouver Berlin

sales@bocci.com europe@bocci.com www.bocci.com www.bocci.com

approx 1.1kg (2.4lb)

MINI OUTIE CANOPY



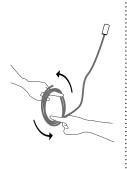

1

Very carefully uncoil the braided coaxial cable in a spool like manner. Insert your index fingers into opposite sides of the roll then rotate your fingers around each other to unroll the coaxial cable.


Use patience: allow the cable to uncoil completely to avoid kinks.



Drill a 9mm (0.35") diameter hole in ceiling material. Pull low voltage house wire through the

2

Note: This low voltage wire will run to a remote mounted power supply.




Determine the overall drop for the pendant fixture. Use the 2mm Allen key to loosen the setscrew in the canopy and gently feed the cable through the canopy until you have reached your desired drop length. Use Allen key to tighten the setscrew to hold the strain relief and secure the coaxial cable at its new length.

## DO NOT OVERTIGHTEN.

Note: The strain relief is a black plastic collar around the coaxial cable. There is a single slot opening on the side of the strain relief component. It is essential that this opening is oriented at 90 degrees to set screw chamber. There can be no contact between the set screw and the cable.

RISK OF ELECTRIC SHORT!

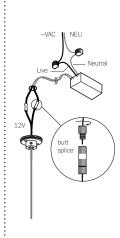

Xenon (110V) or LED: connect the black wire to black and white wire to white wire. Xenon (230V): connect

black wire to brown wire and white wire to blue

Connect the house wires to the coaxial cable using #16 butt splices (stagger the splices). Use raw butt splices and heat shrink to simplify the installation.

For multiple pendant installations, ensure that the braided outer wires are all connected to one 12V output wire and all inner insulated wires are connected to the other or a short will occur.

Note: Insulated core is positive and braided exterior is negative.




5

The client is responsible to ensure fasteners are attached to a robust structural substrate.

Affix mini-canopy to ceiling surface with fasteners provided. Twist the threaded outie cover into place.

Turn power to fixture on.




6

Use silicone caulking to fill the seam between the ceiling and the canopy.

Note: mask the coaxial cable off with painters tape to help with cleanup.

Paint over entire assembly.



Plug the lamp into the socket. Do not touch the lamp with your bare hands. Ensure power to lamp is working correctly.

Remove the center cap from 28 pendant. Install 28 pendant by sliding the center cap onto the coaxial cable, gently insert the lamp into the pedant, then tighten the center cap connection by hand.

DO NOT OVERTIGHTEN.

Remove the protective film from the center cap after assembly.

Note: when using a dimmer use only low voltage electronic dimmer.

Bocci lamps are included.

7

Remove masking tape and clean fingerprints from glass surfaces.

For additional assistance. please contact Bocci:

Vancouver

sales@bocci.com www.bocci.com

Berlin

europe@bocci.com www.bocci.com

US Patent # D687,740 EU Patent # 001695834-001 to 004

Made in Vancouver, Canada







